


1/21/2022 2:17:20 PM
R:\Data\Community Development Partners\CDP Salem Gateway\Civil\Plots-Subdivision\EC-9 Tree Conservation N-S.dwg (EC-9 tab)

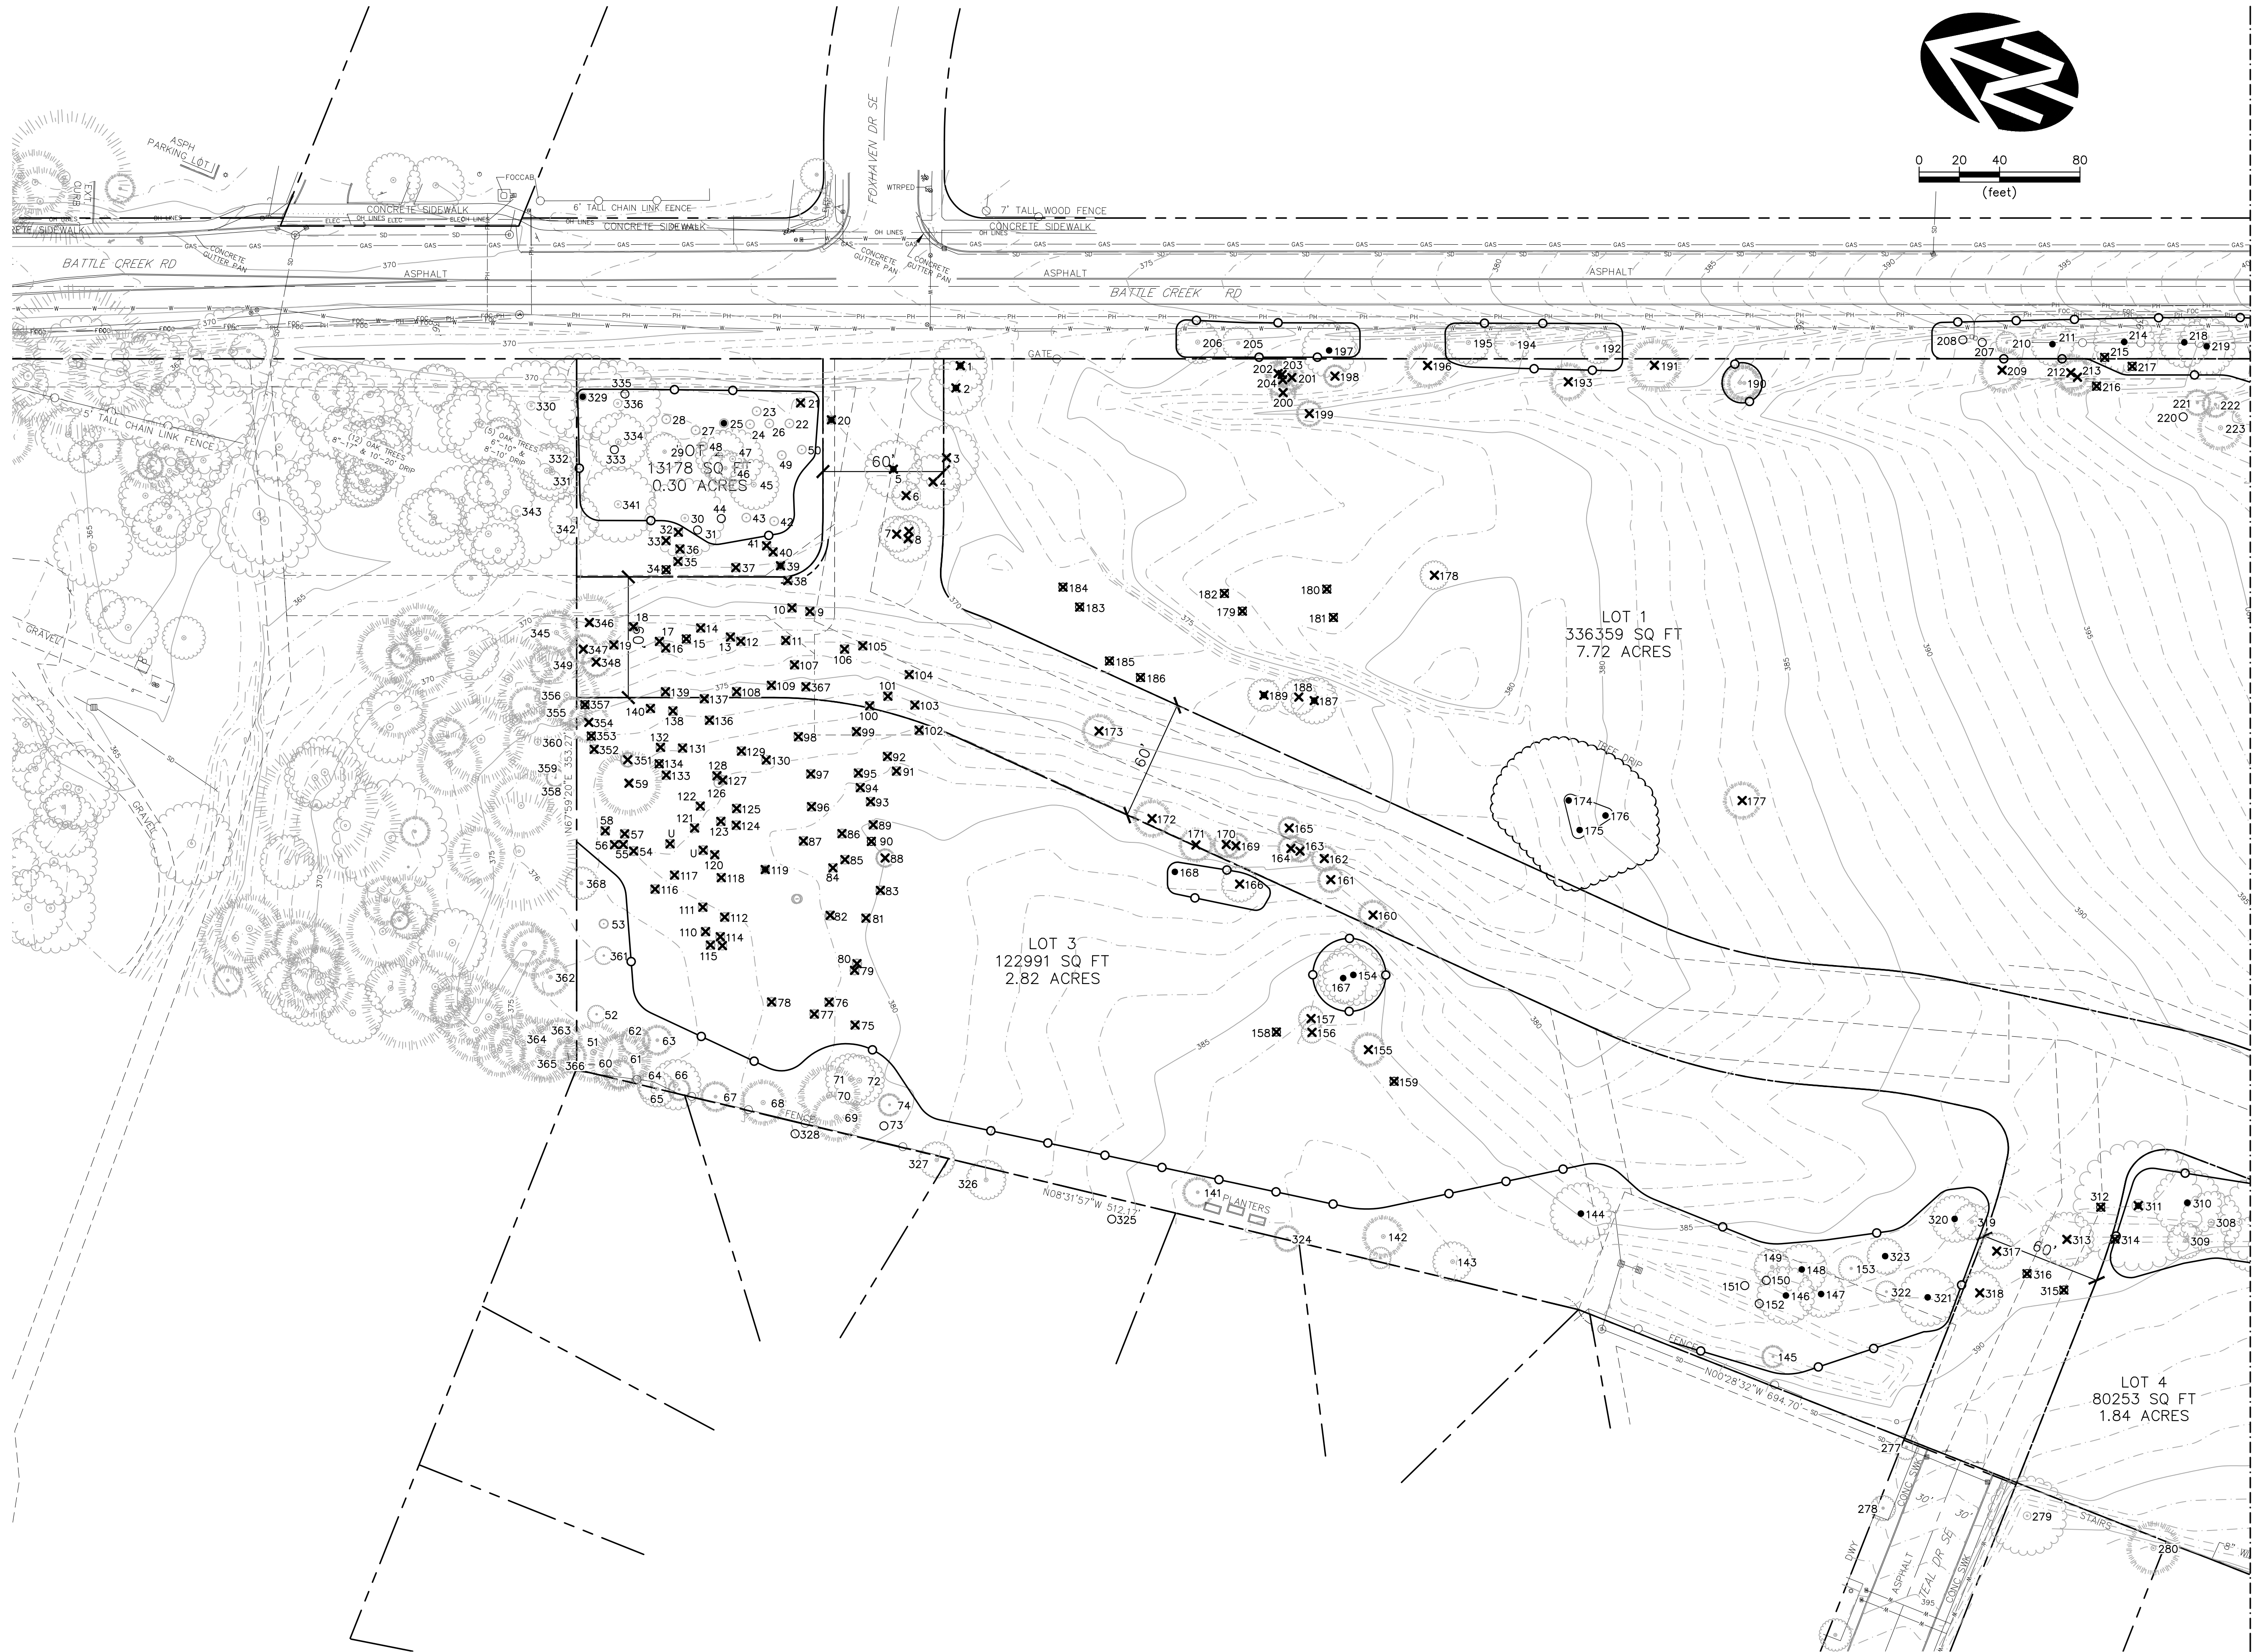

MATCHLINE - SEE DWG EC-10 FOR CONTINUATION

WOODSCAPE GLEN, LLC.
WOODSCAPE GREEN NORTH SUBDIVISION
TREE CONSERVATION PLAN
NORTH

DRAWING
EC-9
JOB NUMBER
2152.1112.0


WESTECH ENGINEERING, INC.
CONSULTING ENGINEERS AND PLANNERS
3841 Fairview Industrial Dr. S.E., Suite 100, Salem, OR 97302
Phone: (503) 585-2474 Fax: (503) 585-3986
E-mail: westech@westech-eng.com

REGISTERED PROFESSIONAL ENGINEER
REVIEW
STEVEN A. L. GIBLIN
6/20/2022

VERIFICATION SCALE
BAR IS ONE INCH ON ORIGINAL DRAWING
IF NOT ONE INCH ON SCALES ACCORDINGLY

NO.	DATE	DESCRIPTION	BY
1	NOV 2021	SAW AR	SAW

MATCHLINE - SEE DWG EC-9 FOR CONTINUATION

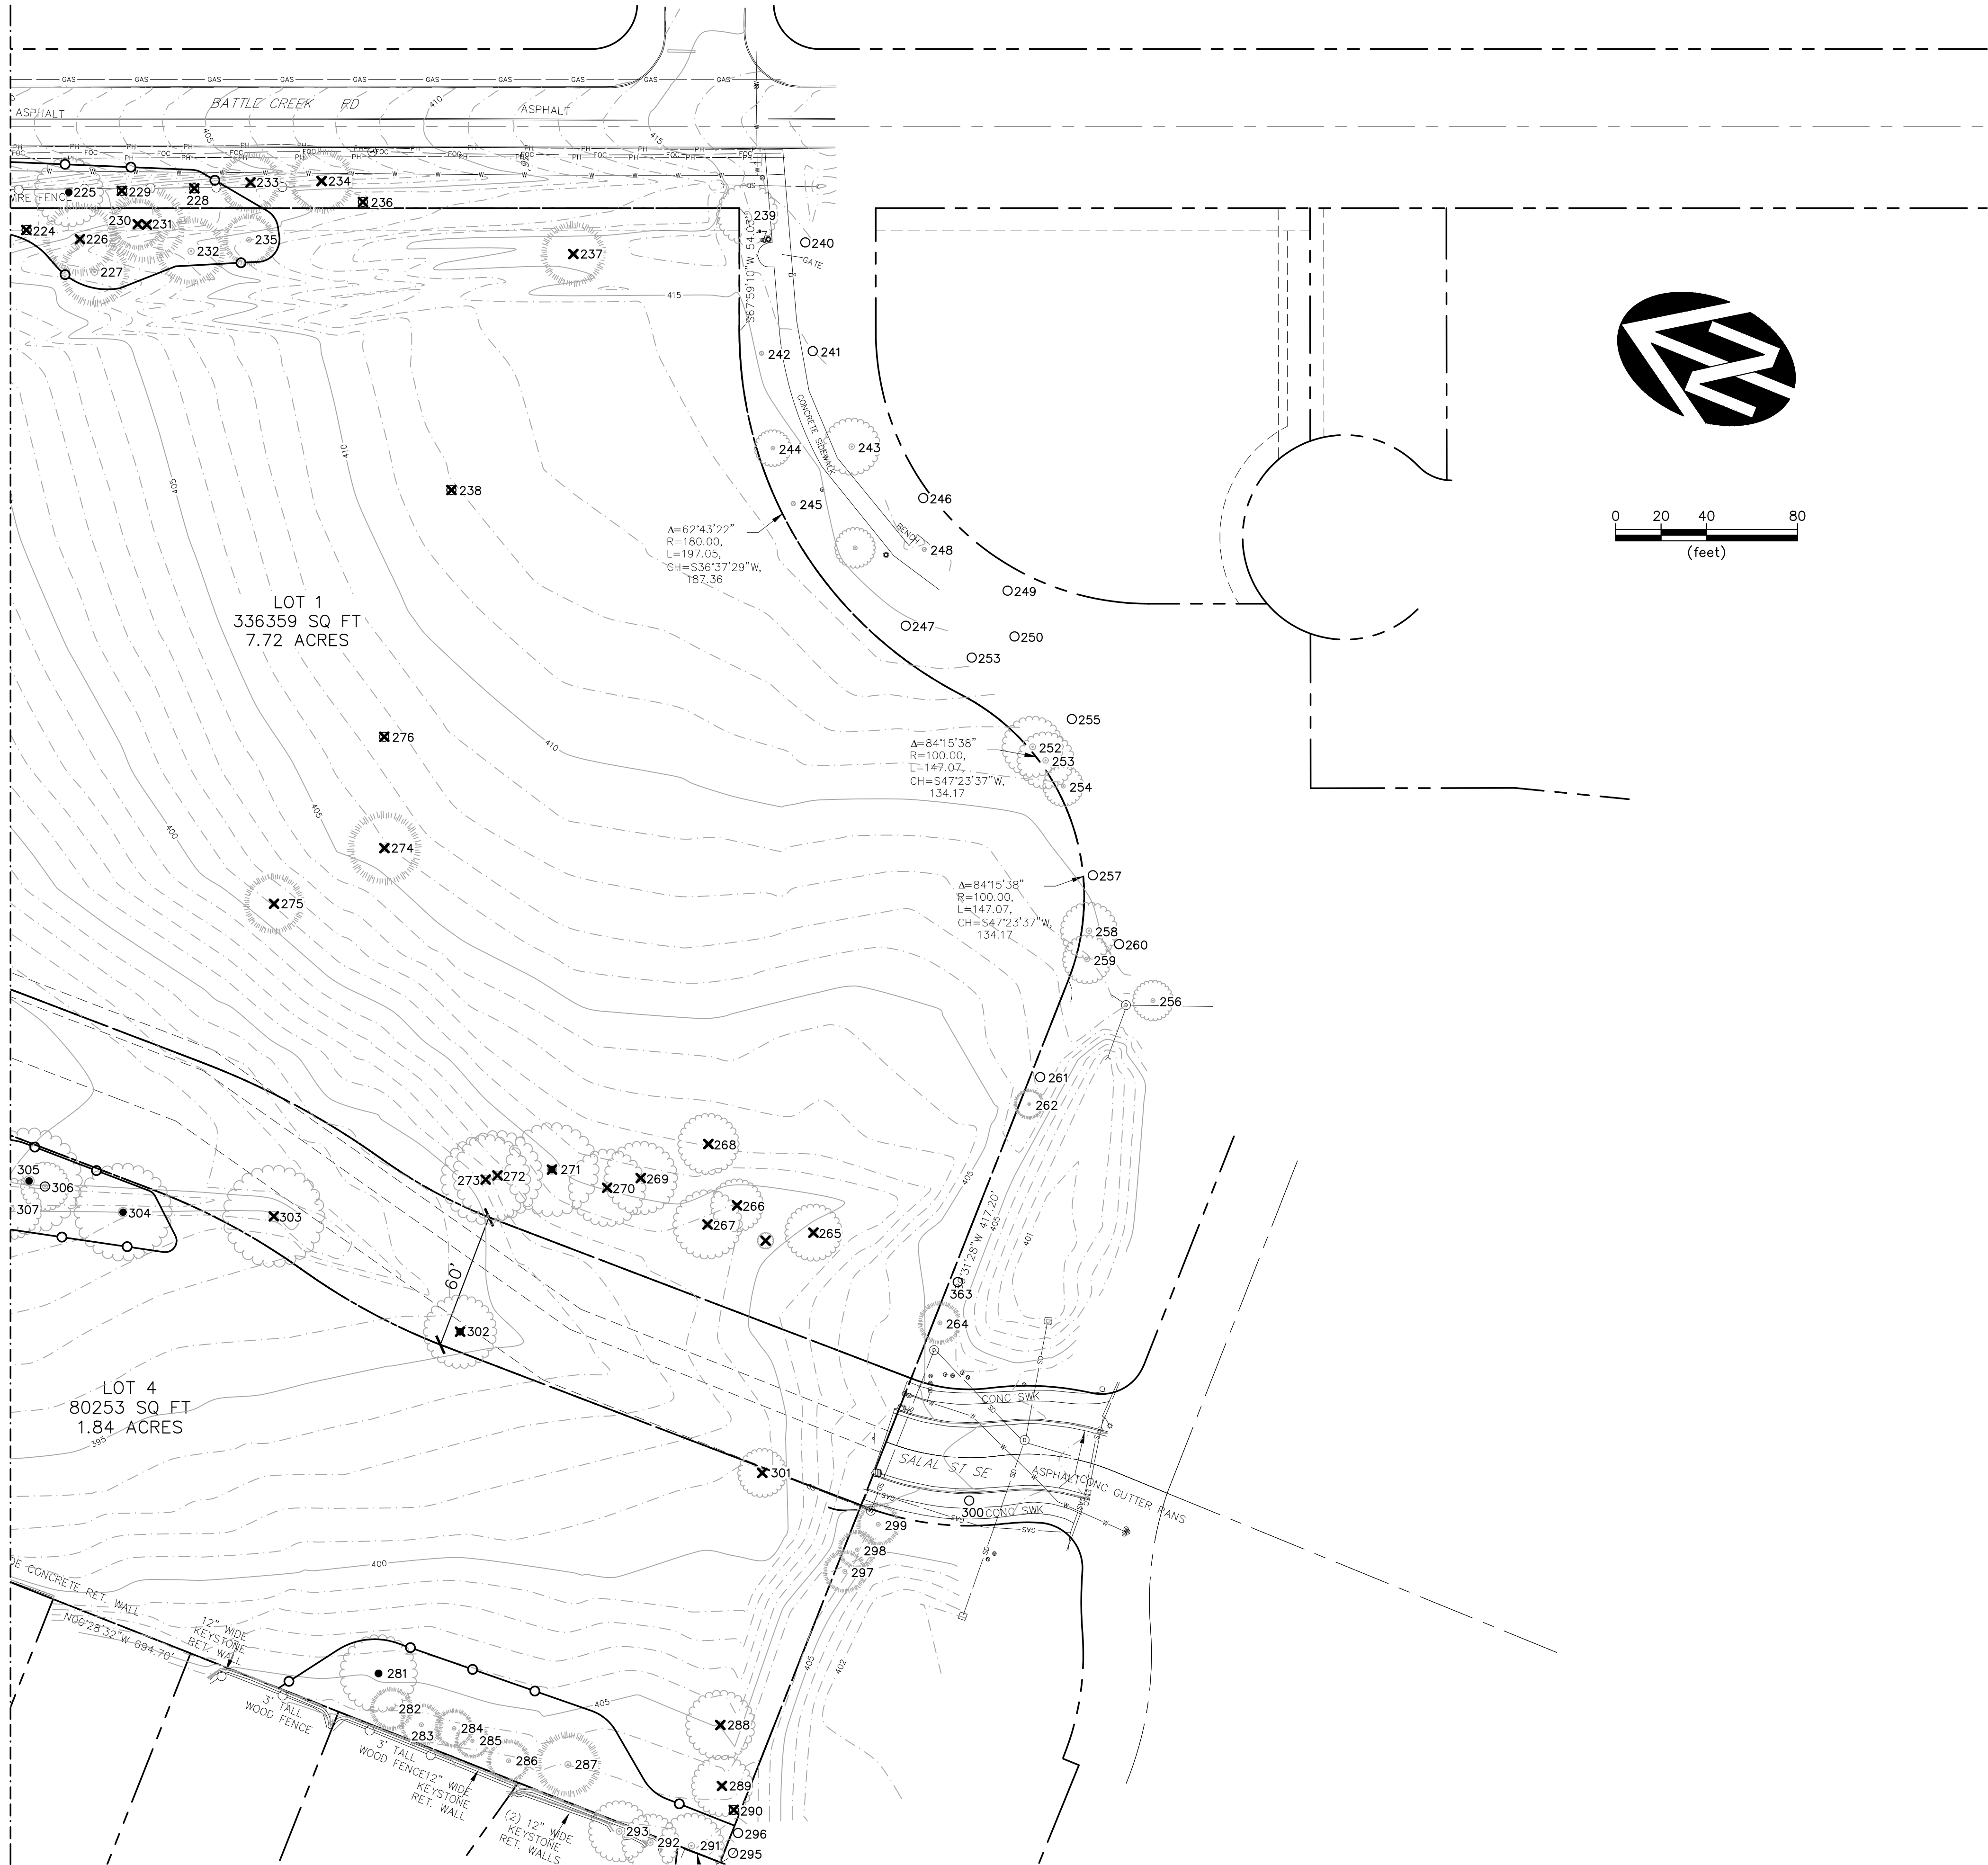

WOODSCAPE GLEN, LLC.		WOODSCAPE GREEN NORTH SUBDIVISION		DRAWING EC-10	
TREE CONSERVATION PLAN SOUTH		JOB NUMBER 2152.1112.0		DATE: NOV 2021	
WESTECH ENGINEERING, INC. CONSULTING ENGINEERS AND PLANNERS 3841 Fairview Industrial Dr. S.E., Suite 100, Salem, OR 97302 Phone: (503) 585-2474 Fax: (503) 585-3986 E-mail: westech@westech-eng.com		REVIEW PROFESSIONAL ENGINEER GIVEN STEVEN A. GIBLIN REVIEW 16 DATE 11/16/2021		DATE: NOV 2021	
VERIFY SCALE BAR IS ONE INCH ON ORIGINAL DRAWING IF NOT ONE INCH ON ORIGINAL DRAWING SCALES ACCORDINGLY		DSN. SAW DRN. AR CKD. SAW		NO. 1 DATE DESCRIPTION REVISIONS	

TREE ID	SPECIES	SCIENTIFIC	V	D/E	COND	SIG	DBH	SHEET #	OFF	LOCATION NOTES	NUISANCE	TREE CONDITION NOTES	
ARBORIST REPORT 1. COMPLETE TREE SURVEY for CDP PROJECT, BATTLE CREEK RD. SALEM, OR (covering taxlots detailed in WESTECH ENGINEERING Land Survey of 06/01/21)													
DEFINITIONS: D/E: Deciduous or Evergreen; COND: Category of tree condition; DBH: Trunk diameter at 4.5-ft ht.; R-RP2: Recommended root protection radius; LOCATION: Immediate area; NUISANCE: Trees considered invasive by the City of Salem (S) within the Region (R); OFF: Partial or complete offsite ownership; SHEET: Tree sheet # in Arb Report; SIG: Trees considered 'Significant' by City of Salem (Oregon oaks 24-inches DBH and over. TREE NOTES: Detail on tree condition V: VALUE Consultant assessment of a high value tree (size, quality, & resistance to construction impacts)													
Abbreviations: CP - Concrete Pad; CR - Tree crown; CS - Crown spread; FL - Fence line; FP - Foot Path; LCR - Live Crown Ratio; NFE - Not fully examined; PL - Parking Lot; R - Radius; RF - Root flare; ROW - Right-of-Way;													
TREE ID	SPECIES	SCIENTIFIC	V	D/E	COND	SIG	DBH	SHEET #	OFF	LOCATION NOTES	NUISANCE	TREE CONDITION NOTES	SAVE/REMOVE
1	Oregon white oak	Quercus garryana		D	Fair		19	S1		At east property line		Canopy subdominant	REMOVE
2	Oregon white oak	Quercus garryana		D	Good	YES	28	S1				Complete canopy. Ivy prevalent	REMOVE
3	Oregon white oak	Quercus garryana		D	Good		23	S1				Thick ivy growth on stem	REMOVE
4	Oregon white oak	Quercus garryana		D	Good/Fair	YES	30	S1				Twin stems. Canopy subdominant	REMOVE
5	Oregon white oak	Quercus garryana		D	Fair/Good	YES	36	S1				Broken leader on NW side	REMOVE
6	Oregon white oak	Quercus garryana		D	Fair/Poor		10	S1				Subdominant in canopy	REMOVE
7	Oregon white oak	Quercus garryana		D	Fair		16	S1				Subdominant in canopy. Heavy ivy growth	REMOVE
8	Oregon white oak	Quercus garryana		D	Fair		19	S1				Subdominant in canopy	REMOVE
9	Douglas fir	Pseudotsuga menziesii		E	Good		13	S1				Semi-mature	REMOVE
10	Douglas fir	Pseudotsuga menziesii		E	Good		15	S1				Semi-mature	REMOVE
11	Douglas fir	Pseudotsuga menziesii		E	Good		30	S1		W edge of easement		Canopy dominant	REMOVE
12	Douglas fir	Pseudotsuga menziesii		E	Good		29	S1		W edge of easement		Canopy dominant. Large CR	REMOVE
13	Douglas fir	Pseudotsuga menziesii		E	Good		23	S1		W edge of easement		Canopy codominant	REMOVE
14	Douglas fir	Pseudotsuga menziesii		E	Good		26	S1		W edge of easement		Canopy codominant	REMOVE
15	Douglas fir	Pseudotsuga menziesii		E	Fair/Good		16	S1		W edge of easement		Subdominant in canopy	REMOVE
16	Douglas fir	Pseudotsuga menziesii		E	Good/Fair		17	S1		W edge of easement		Canopy codominant	REMOVE
17	Douglas fir	Pseudotsuga menziesii		E	Good		24	S1		W edge of easement		Canopy codominant	REMOVE
18	Douglas fir	Pseudotsuga menziesii		E	Good		29	S1		W edge of easement		Canopy dominant. Open growing CR	REMOVE
19	Douglas fir	Pseudotsuga menziesii		E	Good		16	S1		W edge of easement		Canopy codominant	REMOVE
20	Oregon white oak	Quercus garryana		D	Good/Fair	YES	28	S1		S edge of easement		Canopy codominant	REMOVE
21	Oregon white oak	Quercus garryana		D	Fair		11	S1				Damaged CR	REMOVE
22	Oregon white oak	Quercus garryana		D	Dying		12	S1				Missing upper CR	SAVE
23	Oregon white oak	Quercus garryana		D	Good/Fair		20	S1				Twin stems. Canopy dominant	SAVE
24	Oregon white oak	Quercus garryana		D	Dying		10	S1				Missing CR	SAVE
25	Oregon white oak	Quercus garryana		D	Fair	YES	34	S1				3 stems. Partial CR failure and CR damage	SAVE
26	Oregon white oak	Quercus garryana		D	Fair/Good		23	S1					SAVE
27	Oregon white oak	Quercus garryana		D	Fair/Good		10	S1					SAVE
28	Oregon white oak	Quercus garryana		D	Good/Fair		11	S1				Canopy codominant	SAVE
29	Oregon white oak	Quercus garryana		D	Fair/Good		15	S1				Canopy codominant. One stem declining	SAVE
30	Oregon white oak	Quercus garryana		D	Fair/Good		10	S1				Small CR	SAVE
31	Oregon white oak	Quercus garryana		D	Fair/Good		14	S1				Twin stems. Reduced CR size	SAVE
32	Oregon ash	Fraxinus latifolia		D	Poor		10	S1				CR damage	REMOVE
33	Oregon ash	Fraxinus latifolia		D	Poor/Fair		11	S1				CR damage	REMOVE
34	Oregon ash	Fraxinus latifolia		D	Poor		11	S1				CR decline	REMOVE
35	Oregon ash	Fraxinus latifolia		D	Poor		11	S1				CR decline	REMOVE
36	Douglas fir	Pseudotsuga menziesii		E	Dead		10	S1					REMOVE
37	Douglas fir	Pseudotsuga menziesii		E	Dead		10	S1				CR absent	REMOVE
38	Douglas fir	Pseudotsuga menziesii		E	Dead		13	S1				CR absent	REMOVE
39	Oregon white oak	Quercus garryana		D	Fair	YES	28	S1				Thin CR	REMOVE
40	Oregon white oak	Quercus garryana		D	Poor		10	S1				Small CR. Canopy subdominant	REMOVE
41	Oregon white oak	Quercus garryana		D	Fair		12	S1				Narrow CR. Canopy subdominant	REMOVE
42	Oregon white oak	Quercus garryana		D	Fair/Good		20	S1				Canopy dominant. Narrow CR form	SAVE
43	Oregon white oak	Quercus garryana		D	Good		14	S1				Narrow CR. Codominant in canopy	SAVE
44	Oregon white oak	Quercus garryana		D	Fair		17	S1				Partial CR failure	SAVE
45	Oregon white oak	Quercus garryana		D	Good/Fair		11	S1				Canopy codominant	SAVE
46	Oregon white oak	Quercus garryana		D	Fair/Good		11	S1				Canopy codominant	SAVE
47	Oregon white oak	Quercus garryana		D	Good/Fair		14	S1				Canopy codominant	SAVE
48	Oregon white oak	Quercus garryana		D	Fair		15	S1				Declining CR	SAVE
49	Oregon white oak	Quercus garryana		D	Fair/Good		17	S1				Declining CR	SAVE
50	Oregon white oak	Quercus garryana		D	Fair/Poor		16	S1				Canopy dominant	SAVE

TREE ID	SPECIES	SCIENTIFIC	V	D/E	COND	SIG	DBH	SHEET #	OFF	LOCATION NOTES	NUISANCE	TREE CONDITION NOTES	SAVE/REMOVE D
51	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		41	S2				Canopy dominant	SAVE
52	Oregon white oak	<i>Quercus garryana</i>		D	Dying		10	S2				CR mostly absent	SAVE
53	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dying		22	S2				Lost leader. Stem defect	SAVE
54	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		24	S2				Canopy dominant	REMOVE
55	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		18	S2				Canopy dominant	REMOVE
56	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		18	S2				Canopy codominant	REMOVE
57	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		12	S2				Canopy dominant	REMOVE
58	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		21	S2				Canopy dominant	REMOVE
59	Douglas fir	<i>Pseudotsuga menziesii</i>	High	E	Good		35	S2				Canopy dominant.	REMOVE
60	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		36	S2				Canopy dominant. Two large stems from 2-ft	SAVE
61	Douglas fir	<i>Pseudotsuga menziesii</i>	High	E	Good		23	S2				Canopy codominant	SAVE
62	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		19	S2				Canopy codominant. Natural stem bend	SAVE
63	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		12	S2				Overtopped	SAVE
64	Oregon white oak	<i>Quercus garryana</i>		D	Fair		15	S2	OFF	Inside fence of adjacent property		NFE Canopy codominant	SAVE
65	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		17	S2	OFF	Inside fence of adjacent property		NFE Canopy codominant	SAVE
66	Oregon white oak	<i>Quercus garryana</i>		D	Fair/Poor		16	S2				Leaning under canopy	SAVE
67	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		14	S2		2-ft from propline		Canopy codominant	SAVE
68	Douglas fir	<i>Pseudotsuga menziesii</i>	High	E	Good		23	S2		5-ft from fence line		Canopy dominant.	SAVE
69	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		35	S2		6-ft from fence line		Canopy dominant.	SAVE
70	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		36	S2				Canopy dominant.	SAVE
71	Oregon white oak	<i>Quercus garryana</i>		D	Fair		16	S2				Damaged CR	SAVE
72	Oregon white oak	<i>Quercus garryana</i>		D	Fair		15	S2				Strongly leaning stem	SAVE
73	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		13	S2				Canopy codominant	SAVE
74	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		21	S2				Canopy codominant	SAVE
75	Oregon white oak	<i>Quercus garryana</i>		D	Good		20	S2				Strong CR development	REMOVE
76	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		10	S2				Canopy codominant	REMOVE
77	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		10	S2					REMOVE
78	Douglas fir	<i>Pseudotsuga menziesii</i>	High	E	Good		31	S2				Canopy dominant.	REMOVE
79	Douglas fir	<i>Pseudotsuga menziesii</i>	High	E	Good		39	S2				Canopy dominant.	REMOVE
80	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		12	S2				Canopy codominant	REMOVE
81	Oregon white oak	<i>Quercus garryana</i>		D	Dying		28	S2				Collapsed stem. Tree is dying	REMOVE
82	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		10	S2				Very narrow CR form	REMOVE
83	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		36	S2				Canopy dominant.	REMOVE
84	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		10	S2					REMOVE
85	Oregon white oak	<i>Quercus garryana</i>		D	Poor		21	S2				Sig damaged CR	REMOVE
86	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		29	S2				Canopy codominant	REMOVE
87	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		23	S2				Canopy codominant	REMOVE
88	Oregon white oak	<i>Quercus garryana</i>		D	Fair		10	S2				Canopy subdominant	REMOVE
89	Oregon white oak	<i>Quercus garryana</i>		D	Fair		10	S2				Canopy subdominant	REMOVE
90	Oregon white oak	<i>Quercus garryana</i>		D	Fair		10	S2				Canopy subdominant	REMOVE
91	Douglas fir	<i>Pseudotsuga menziesii</i>	High	E	Good		38	S2				Canopy dominant.	REMOVE
92	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		39	S2				Canopy dominant.	REMOVE

WOODSCAPE GLEN, LLC.		WOODSCAPE GREEN NORTH SUBDIVISION		DRAWING EC-11		JOB NUMBER 2152.1112.0	
 WESTECH ENGINEERING, INC. CONSULTING ENGINEERS AND PLANNERS		3841 Fairview Industrial Dr. S.E., Suite 100, Salem, OR 97302 Phone: (503) 585-2474 Fax: (503) 585-3986 E-mail: westech@westech-eng.com		 REVIEW		VERIFY SCALE BAR IS ONE INCH ON ORIGINAL DRAWING 0  1" MUST ONE INCH ON THIS SHEET. ADJUST SCALES ACCORDINGLY	
				DSN: SAW			
				DRN: AR			
				CKD: SAW			
				NO. 1			
				DATE		DESCRIPTION	
				DATE: NOV 2021		REVISIONS	
				REVIEWS: 6/30/2022			

Tree ID	Species	Scientific	V	D/E	Cond	Sig	DBH	Sheet #	Off	Location Notes	NUSA NCE	Tree Condition Notes	Save/Remove D
105	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Fair/Good		26	S1				Thin CR	REMOVE
106	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Fair/Good		24	S1				Thin CR. Twin stems	REMOVE
107	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		10	S1					REMOVE
108	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		24	S1				Canopy dominant. Narrow CR form	REMOVE
109	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Poor		24	S1				Significant CR decline	REMOVE
110	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		20	S2				Canopy dominant. No defects noted	REMOVE
111	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		10	S2					REMOVE
112	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Fair/Good		15	S2				Twin stems	REMOVE
113	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		12	S2					REMOVE
114	Oregon white oak	<i>Quercus garryana</i>		D	Dying		21	S2				Three separated stems	REMOVE
115	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		11	S2				Closely spaced with other stems	REMOVE
116	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		16	S2					REMOVE
117	Oregon white oak	<i>Quercus garryana</i>		D	Dying		11	S2				Fallen tree. Crown damaged	REMOVE
118	Oregon white oak	<i>Quercus garryana</i>		D	Poor		10	S2				Reduced CR form	REMOVE
119	Oregon white oak	<i>Quercus garryana</i>		D	Fair	YES	32	S2				Three spreading stems	REMOVE
120	Oregon white oak	<i>Quercus garryana</i>		D	Poor		10	S2				Tree in decline	REMOVE
121	Sweet cherry	<i>Prunus avium cultivar</i>		D	Dying		12	S2			Yes (R)	Tree failed and hanging in adjacent tree	REMOVE
122	Sweet cherry	<i>Prunus avium cultivar</i>		D	Good		12	S2			Yes (R)		REMOVE
123	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		20	S2				Narrow CR form	REMOVE
124	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		20	S2				Narrow CR form	REMOVE
125	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		10	S2				CR absent	REMOVE
126	Oregon white oak	<i>Quercus garryana</i>		D	Fair		11	S2				Canopy codominant	REMOVE
127	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		10	S2				Canopy codominant	REMOVE
128	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		23	S2				Canopy dominant.	REMOVE
129	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		11	S2				Canopy codominant	REMOVE
130	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		26	S2				Thin CR	REMOVE
131	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		10	S2				Canopy codominant	REMOVE
132	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		11	S2				Canopy codominant	REMOVE
133	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		15	S2				Reduced CR form	REMOVE
134	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		11	S2				No CR remaining	REMOVE
135													OFFSITE
136	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		16	S2				Narrow CR form	REMOVE
137	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		12	S2				Canopy codominant	REMOVE
138	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		35	S2				High LCR	REMOVE
139	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		30	S2				Canopy dominant. Spaced apart	REMOVE
140	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Fair		11	S2				Narrow thinning CR	REMOVE
141	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		20	S4				Twin stem tree. 1/4 of CR shaded asymmetric	SAVE
142	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		24	S4				Spaced apart in canopy. Strong CR	SAVE
143	Oregon white oak	<i>Quercus garryana</i>		D	Dead		24	S4				Tree removed. 28-inch diam stump at cut	SAVE
144	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair	YES	56	S4				Over mature tree. Heavy ivy cover	SAVE
145	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		12	S4		12-ft from fence line		Semi mature tree. Spaced apart	SAVE
146	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	29	S4		Within drainage draw		Twin stems. Spreading CR	SAVE
147	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	24	S4		Within drainage draw		Canopy codominant	SAVE
148	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	29	S4		Within drainage draw		Three stems	SAVE
149	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		12	S4		Within drainage draw		Low shrubby CR	SAVE
150	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		12	S4		Within drainage draw		Upright CR broken branches upper CR	SAVE
151	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		14	S4		Within drainage draw		Low shrubby CR	SAVE
152	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		12	S4		Within drainage draw		Low shrubby CR	SAVE
153	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		10	S4		Within drainage draw		Low shrubby CR	SAVE
154	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	39	S4				Two very large stems. Thinning CR	SAVE
155	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		22	S4				Canopy dominant tree. Strong CR development	REMOVE
156	Sweet cherry	<i>Prunus avium cultivar</i>		D	Fair		11	S4			Yes (R)		REMOVE
157	Sweet cherry	<i>Prunus avium cultivar</i>		D	Fair		10	S4			Yes (R)		REMOVE
158	Oregon white oak	<i>Quercus garryana</i>		D	Poor		12	S4				Twin stems. CR damaged and declining	REMOVE
159	Sweet cherry	<i>Prunus avium cultivar</i>		D	Fair		13	S4			Yes (R)		REMOVE

TREE ID	SPECIES	SCIENTIFIC	V	D/E	COND	SIG	DBH	SHEET #	OFF	LOCATION NOTES	NUSA NCE	TREE CONDITION NOTES	SAVE/REMOVE D
160	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		20	S3		Within public utility easement		Twin stems	REMOVE
161	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		15	S3				Semi-mature tree	REMOVE
162	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		14	S3				Narrow CR form	REMOVE
163	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Dead		10	S3					REMOVE
164	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		12	S3				Trees tightly space together	REMOVE
165	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		12	S3				Trees tightly space together	REMOVE
166	Oregon white oak	<i>Quercus garryana</i>		D	Good		11	S4				Narrow CR form	REMOVE
167	Sweet cherry	<i>Prunus avium cultivar</i>		D	Poor		15	S3			Yes (R)	Damaged CR under oak canopy	SAVE
168	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	24	S4				Semi-mature. Twin stems	SAVE
169	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		12	S3				Semi-mature.	REMOVE
170	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		11	S3				Semi-mature.	REMOVE
171	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		15	S3				Semi-mature.	REMOVE
172	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		18	S3				Semi-mature.	REMOVE
173	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		21	S3				Semi-mature.	REMOVE
174	Oregon white oak	<i>Quercus garryana</i>		D	Fair	YES	45	S3		Grouping of 3 mature trees		Multiple broken limbs mid CR. Storm damage	SAVE
175	Oregon white oak	<i>Quercus garryana</i>		D	Fair		21	S3		Grouping of 3 mature trees		Asymmetric CR form. Reduced CR and damage	SAVE
176	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	36	S3		Grouping of 3 mature trees		Twin stems from ground. Shaded half CR form	SAVE
177	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		21	S3				Storm damage upper CR	REMOVE
178	Black cottonwood	<i>Populus trichocarpa</i>		D	Poor		17	S3				Significant damage. No upper CR	REMOVE
179	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		11	S3				Semi-mature.	REMOVE
180	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		10	S3				Semi-mature.	REMOVE
181	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		12	S3				Semi-mature.	REMOVE
182	Sweet cherry	<i>Prunus avium cultivar</i>		D	Good/Fair		13	S3			Yes (R)	Narrow forks	REMOVE
183	Black cottonwood	<i>Populus trichocarpa</i>		D	Fair		10	S1				Damaged upper CR	REMOVE
184	Black cottonwood	<i>Populus trichocarpa</i>		D	Good/Fair		26	S1				Branch breakage within CR	REMOVE
185	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		11	S3				Naturally leaning stem	REMOVE
186	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		36	S3				Large tree with twin stems. Early maturity	REMOVE
187	Oregon white oak	<i>Quercus garryana</i>		D	Fair	YES	44	S3				Large bole. Multiple large broken limbs	REMOVE
188	Oregon white oak	<i>Quercus garryana</i>		D	Fair		19	S3				Canopy codominant. Basal lesions	REMOVE
189	Oregon white oak	<i>Quercus garryana</i>		D	Fair	YES	24	S3				Damage and decay on lower stem	REMOVE
190	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		17	S3				Semi-mature	SAVE
191	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		22	S3				Minor storm damage	REMOVE
192	Oregon white oak	<i>Quercus garryana</i>		D	Good		15	S3	OFF	ROW At edge of ROW ditch		Low spreading CR	SAVE
193	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		26	S3					REMOVE
194	Oregon white oak	<i>Quercus garryana</i>		D	Good		18	S3	OFF	ROW At edge of ROW ditch		Low spreading CR	SAVE
195	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		22	S3	OFF	ROW At edge of ROW ditch		Strong upper CR	SAVE
196	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		27	S3				Some root disease likley. No hazard at present	REMOVE
197	Oregon white oak	<i>Quercus garryana</i>		D	Fair	YES	29	S3	OFF	ROW At edge of ROW ditch		Thin upper CR	SAVED
198	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		10	S3				Thin upper CR	REMOVE
199	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		17	S3					REMOVE
200	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		15	S3				Close grouping. Good vigorous growth	REMOVE

WOODSCAPE GLEN, LLC.		WOODSCAPE GREEN NORTH SUBDIVISION		DRAWING EC-12		JOB NUMBER 2152.1112.0	
WOODSCAPE GREEN NORTH SUBDIVISION		TREE PROTECTION SUMMARY		DRAWING EC-12		JOB NUMBER 2152.1112.0	

TREE ID	SPECIES	SCIENTIFIC	V	D/E	COND	SIG	DBH	SHEET #	OFF	LOCATION NOTES	NUISA NCE	TREE CONDITION NOTES	SAVE/REMOVE D
214	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	34	S5	OFF	ROW At edge of ROW ditch		Spreading CR	SAVE
215	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		12	S5				Lost upper leader; resolving defect	REMOVE
216	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		16	S5					REMOVE
217	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		17	S5					REMOVE
218	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	38	S5	OFF	ROW At edge of ROW ditch		Large spreading CR	SAVE
219	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair	YES	39	S5	OFF	ROW At edge of ROW ditch		Limb failures from storm damage	SAVE
220	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		10	S5					SAVE
221	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		13	S5					SAVE
222	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		14	S5					SAVE
223	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		23	S5					SAVE
224	Oregon white oak	<i>Quercus garryana</i>		D	Fair		10	S5				Suppressed under #219	REMOVE
225	Oregon white oak	<i>Quercus garryana</i>		D	Fair	YES	28	S5	OFF	ROW At edge of ROW ditch		Lost upper CR	SAVE
226	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		15	S5				Strong CR development	REMOVE
227	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		24	S5				Strong CR development	SAVE
228	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		13	S5	OFF	ROW At edge of ROW ditch		Codominant in canopy	REMOVE
229	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		16	S5	OFF	ROW At edge of ROW ditch		Storm damage in CR	REMOVE
230	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		12	S5				Strong CR development	REMOVE
231	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		18	S5				Strong CR development	REMOVE
232	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		13	S5				Lower stem bend	SAVE
233	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		37	S5	OFF			Old tree, pre ROW development	REMOVE
234	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		42	S5	OFF			Old tree.Codom stems from 30-ft	REMOVE
235	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		10	S5				Young tree	SAVE
236	Sweet cherry	<i>Prunus avium cultivar</i>		D	Fair		10	S5	OFF		Yes (R)	Partially suppressed	REMOVE
237	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		17	S5					REMOVE
238	Domestic pear	<i>Pyrus domestica</i>		D	Fair/Good		12	S5		In pasture area		Twin leaders from 2-ft	REMOVE
239	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Good/Fair		14	S5	OFF	Within adjacent undeveloped ROW		Some CR damage	OFFSITE
240	Giant sequoia	<i>Sequoiadendron gigant.</i>		E	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
241	Oregon white oak	<i>Quercus garryana</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
242	Oregon white oak	<i>Quercus garryana</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
243	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Good		11	S5	OFF	Within adjacent undeveloped ROW			OFFSITE
244	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Good/Fair		7	S5	OFF	Within adjacent undeveloped ROW		CR dieback evident	OFFSITE
245	Unknown spp	<i>Unknown spp</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
246	European beech	<i>Fagus sylvatica</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
247	Oregon white oak	<i>Quercus garryana</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
248	Oregon white oak	<i>Quercus garryana</i>		D	Fair		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree. CR dieback	OFFSITE
249	Oregon white oak	<i>Quercus garryana</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
250	Oregon white oak	<i>Quercus garryana</i>		D	Fair		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree. CR dieback	OFFSITE
251	Unknown spp	<i>Unknown spp</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
252	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		18	S5	OFF	Within adjacent undeveloped ROW		Semi-mature	OFFSITE
253	Unknown spp	<i>Unknown spp</i>		D	Fair		15	S5	OFF	Within adjacent undeveloped ROW		Multi-stem tree	OFFSITE
254	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Good		7	S5	OFF	Within adjacent undeveloped ROW			OFFSITE
255	Oregon white oak	<i>Quercus garryana</i>		D	Good		2	S5	OFF	Within adjacent undeveloped ROW		Newly planted tree	OFFSITE
256	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Good		7	S6	OFF	Within adjacent ROW		Young tree	OFFSITE
257	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Poor		6	S6	OFF	Within adjacent ROW		Damaged and part removed upper CR	OFFSITE
258	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		13	S6	OFF	Within adjacent ROW		Semi-mature to Young tree	OFFSITE
259	Black cottonwood	<i>Populus trichocarpa</i>		D	Good/Fair		16	S6	OFF	Within adjacent ROW		Two stems. Upper CR damage	OFFSITE
260	Oregon white oak	<i>Quercus garryana</i>		D	Good		2	S6	OFF	Within adjacent ROW		Newly planted tree	OFFSITE
261	Western red cedar	<i>Thuja plicata</i>		E	Good		6	S6	OFF	Within adjacent ROW. Edge of basin		Young tree	OFFSITE
262	Giant sequoia	<i>Sequoiadendron gigant.</i>		E	Good		15	S6	OFF	Within adjacent ROW. Edge of basin		Low squat CR form	OFFSITE
263	Western red cedar	<i>Thuja plicata</i>		E	Good		6	S6	OFF			Young tree	OFFSITE
264	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Poor		7	S6	OFF	Within adjacent ROW		Severe upper CR damage	OFFSITE
265	Oregon white oak	<i>Quercus garryana</i>		D	Good		11	S6				Small CR	REMOVE
266	Oregon white oak	<i>Quercus garryana</i>		D	Good		15	S6		Within low area			REMOVE

TREE ID	SPECIES	SCIENTIFIC	V	D/E	COND	SIG	DBH	SHEET #	OFF	LOCATION NOTES	NUISA NCE	TREE CONDITION NOTES	SAVE/REMOVE D
267	Oregon white oak	<i>Quercus garryana</i>		D	Good		13	S6		Within low area			REMOVE
268	Oregon white oak	<i>Quercus garryana</i>		D	Good		14	S6		Higher ground than previous trees			REMOVE
269	Oregon white oak	<i>Quercus garryana</i>		D	Good		13	S6				Partial CR damage from #271	REMOVE
270	Oregon white oak	<i>Quercus garryana</i>		D	Fair/Poor		14	S6				Tree fallen, hung up in #271. Damaged CR	REMOVE
271	Oregon white oak	<i>Quercus garryana</i>		D	Fair	YES	36	S6				2 large stems, one stem failed on adj trees	REMOVE
272	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		21	S6				Twin stems. CR space shared with #273	REMOVE
273	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		23	S6				Upper CR damage. CR space shared with #272	REMOVE
274	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		24	S6				Lost leader but lower limbs are sound	REMOVE
275	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Fair		19	S6				Storm damage upper CR	REMOVE
276	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		14	S6				Twin leaders from 4.5-ft	REMOVE
277	Norway maple	<i>Acer platanoides</i>		D	Good		12	S7	OFF	ROW	Yes (S) (R)	NFE Semi-mature	OFFSITE
278	Norway maple	<i>Acer platanoides</i>		D	Good		12	S7	OFF	ROW	Yes (S) (R)	NFE Semi-mature	OFFSITE
279	Norway maple	<i>Acer platanoides</i>		D	Good		13	S7	OFF	Private	Yes (S) (R)	NFE Semi-mature	OFFSITE
280	Western red cedar	<i>Thuja plicata</i>		E	Good		24	S7	OFF	Private		NFE Semi-mature	OFFSITE
281	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	24	S7				Minor branch damage upper CR	SAVE
282	Leyland cypress	<i>Cupressus x leylandii</i>		E	Good		7	S7				Partially supressed	SAVE
283	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good		14	S7					SAVE
284	Eastern white pine	<i>Pinus strobus</i>		E	Good		10	S7					SAVE
285	Eastern white pine	<i>Pinus strobus</i>		E	Good		10	S7					SAVE
286	Eastern white pine	<i>Pinus strobus</i>		E	Fair/Poor		11	S7				Browning foliage 50% CR. May be dying	SAVE
287	Douglas fir	<i>Pseudotsuga menziesii</i>		E	Good/Fair		19	S7				Twin leaders from 15-ft.irregular CR form	SAVE
288	Sweet cherry	<i>Prunus avium cultivar</i>		D	Good		18	S7			Yes (R)	Canopy dominant	REMOVE
289	Sweet cherry	<i>Prunus avium cultivar</i>		D	Fair		18	S7			Yes (R)	Three stems	REMOVE
290	Red elderberry	<i>Sambucus racemosa</i>		D	Poor		10	S7				Large specimen 20-ft ht. Breaking apart	SAVE
291	Sweet cherry	<i>Prunus avium cultivar</i>		D	Good		15	S7			Yes (R)	Large twin stem tree	REMOVE
292	European hornbeam	<i>Carpinus betulus</i>		D	Good/Fair		13	S7	OFF	Private. On 3-ft ht retaining wall		NFE Some damaged branches	OFFSITE
293	European hornbeam	<i>Carpinus betulus</i>		D	Good/Fair		13	S7	OFF	Private. On 3-ft ht retaining wall		NFE Some damaged branches	OFFSITE
294	Western red cedar	<i>Thuja plicata</i>		E	Good		10	S7	OFF	Public land		Semi-mature specimen	OFFSITE
295	Western red cedar	<i>Thuja plicata</i>		E	Good		9	S7	OFF	Public land		Semi-mature specimen	OFFSITE
296	Western red cedar	<i>Thuja plicata</i>		E	Good		6	S7	OFF	Public land		Semi-mature specimen	REMOVE
297	Western red cedar	<i>Thuja plicata</i>		E	Good		7	S7	OFF	Public land		Semi-mature specimen	OFFSITE
298	Western red cedar	<i>Thuja plicata</i>		E	Good		9	S7	OFF	Public land		Semi-mature specimen	OFFSITE
299	Western red cedar	<i>Thuja plicata</i>		E	Good		9	S7	OFF	Public land		Semi-mature specimen	OFFSITE
300	Raywood ash	<i>Fraxinus oxycarpa</i>		D	Good/Fair		6	S7	OFF	ROW. Street planting strip			OFFSITE
301	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		13	S7				Semi-mature. Spreading CR	REMOVE
302	Oregon white oak	<i>Quercus garryana</i>		D	Good		23	S7				Single stem. Complete CR	REMOVE
303	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		22	S7		Within drainage draw		Storm damage. Heavy ivy within CR and stem	REMOVE
304	Oregon white oak	<i>Quercus garryana</i>		D	Fair/Good		22	S7		Within drainage draw		Thinning CR. Included bark at twin stem union	SAVE
305	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		21	S7		Within drainage draw		Canopy dominant. Thinning CR	SAVE
306	Oregon white oak	<i>Quercus garryana</i>		D	Good/Fair		11	S7		Within drainage draw		Subdominant in canopy to #305	SAVE
307	Oregon white oak	<i>Quercus garryana</i>		D	Good		12	S7		Within drainage draw		Slender CR form	SAVE
308	Oregon white oak	<i>Quercus garryana</i>		D	Good		12	S7		Within drainage draw		Spreading CR form	SAVE
309	Oregon white oak	<i>Quercus garryana</i>		D	Good		11	S7		Within drainage draw		Thin CR CR is healthy	SAVE
310	Oregon white oak	<i>Quercus garryana</i>		D	Good		21	S7		Within drainage draw		Fused lower stem. No defects noted	SAVE
311	Oregon white oak	<i>Quercus garryana</i>		D	Good	YES	25	S7		Within drainage draw		Strong open CR	SAVE
312	Oregon white oak	<i>Quercus garryana</i>		D	Poor/Fair		14	S7		Within drainage draw		Strongly supressed	REMOVE
313	Oregon white oak	<i>Quercus garryana</i>		D	Fair/Good		23	S7		Within drainage draw		Narrow CR form	REMOVE
314	Oregon white oak	<i>Quercus garryana</i>		D	Dead		40	S7		Within drainage draw		Large diam tree failed	SAVE
315	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		13	S7		Within drainage draw		Semi-mature.	REMOVE
316	Black cottonwood	<i>Populus trichocarpa</i>		D	Good		13	S7		Within drainage draw		Semi-mature.	REMOVE
317	Oregon white oak	<i>Quercus garryana</i>		D	Good		22	S7		Within drainage draw		Full CR form	REMOVE

01"0

VERIFY SCALE
BAR IS ONE INCH ON
ORIGINAL DRAWING
IF NOT ONE INCH ON
SCALE, INDICATE
SCALES ACCURATELY

DSN. SAW
DRN. AR
CKD. SAW

NO. 1
DATE: NOV 2021

DESCRIPTION
REVISIONS

PROFESSIONAL
ENGINEER
REGISTERED
STATE OF OREGON
NOV 16, 2021
STEVEN A. L. GLEN
REVIEW

WESTTECH ENGINEERING, INC.
CONSULTING ENGINEERS AND PLANNERS
3841 Fairview Industrial Dr. S.E., Suite 100, Salem, OR 97302
Phone: (503) 585-2474 Fax: (503) 585-3986
E-mail: westech@westech-eng.com
REVISIONS: 6/20/2022

WOODSCAPE GLEN, LLC.

WOODSCAPE GREEN NORTH SUBDIVISION

TREE PROTECTION SUMMARY

DRAWING
EC-13

JOB NUMBER
2152.1112.0

ARBORIST REPORT 1. COMPLETE TREE SURVEY for CDP PROJECT, BATTLE CREEK RD. SALEM, OR - Covering Proposed Lot 1 (Phase 1)													
DEFINITIONS: D/E: Deciduous or Evergreen; COND: Category of tree condition; DBH: Trunk diameter at 4.5-ft ht; R-RPZ: Recommended root protection radius ; LOCATION: Immediate area; NUISANCE: Trees considered invasive by the City of Salem (S) within the Region (R); OFF: Partial or complete offsite ownership; SHEET: Tree sheet # in Arb Report; SIG: Trees considered 'Significant' by City of Salem (Oregon oaks 24-inches DBH and over. TREE NOTES: Detail on tree condition V: VALUE Consultant assessment of a high value tree (size, quality, & resistance to construction impacts)													
Abbreviations: CP - Concrete Pad; CR - Tree crown; CS - Crown spread; FL - Fence line; FP - Foot Path; LCR - Live Crown Ratio; NFE - Not fully examined; PL - Parking Lot; R - Radius; RF - Root flare; ROW - Right-of-Way;													
TREE ID	SPECIES	SCIENTIFIC	V	D/E	COND	SIG	DBH	SHEET #	OFF	LOCATION NOTES	NUISANCE	TREE CONDITION NOTES	SAVE/REMOVED
1	Oregon white oak	Quercus garryana		D	Fair		19	S1		At east property line		Canopy subdominant	REMOVE
2	Oregon white oak	Quercus garryana		D	Good	YES	28	S1				Complete canopy. Ivy prevalent	REMOVE
3	Oregon white oak	Quercus garryana		D	Good		23	S1				Thick ivy growth on stem	REMOVE
174	Oregon white oak	Quercus garryana		D	Fair	YES	45	S3		Grouping of 3 mature trees		Multiple broken limbs mid CR. Storm damage	SAVE
175	Oregon white oak	Quercus garryana		D	Fair		21	S3		Grouping of 3 mature trees		Asymmetric CR form. Reduced CR and damage	SAVE
176	Oregon white oak	Quercus garryana		D	Good	YES	36	S3		Grouping of 3 mature trees		Twin stems from ground. Shaded half CR form	SAVE
177	Douglas fir	Pseudotsuga menziesii		E	Good/Fair		21	S3				Storm damage upper CR	REMOVE
178	Black cottonwood	Populus trichocarpa		D	Poor		17	S3				Significant damage. No upper CR	REMOVE
179	Black cottonwood	Populus trichocarpa		D	Good		11	S3				Semi-mature.	REMOVE
180	Douglas fir	Pseudotsuga menziesii		E	Good		10	S3				Semi-mature.	REMOVE
181	Douglas fir	Pseudotsuga menziesii		E	Good		12	S3				Semi-mature.	REMOVE
182	Sweet cherry	Prunus avium cultivar		D	Good/Fair		13	S3			Yes (R)	Narrow forks	REMOVE
183	Black cottonwood	Populus trichocarpa		D	Fair		10	S1				Damaged upper CR	REMOVE
184	Black cottonwood	Populus trichocarpa		D	Good/Fair		26	S1				Branch breakage within CR	REMOVE
185	Black cottonwood	Populus trichocarpa		D	Good		11	S3				Naturally leaning stem	REMOVE
186	Black cottonwood	Populus trichocarpa		D	Good		36	S3				Large tree with twin stems. Early maturity	REMOVE
187	Oregon white oak	Quercus garryana		D	Fair	YES	44	S3				Large bole. Multiple large broken limbs	REMOVE
188	Oregon white oak	Quercus garryana		D	Fair		19	S3				Canopy codominant. Basal lesions	REMOVE
189	Oregon white oak	Quercus garryana		D	Fair	YES	24	S3				Damage and decay on lower stem	REMOVE
190	Douglas fir	Pseudotsuga menziesii		E	Good		17	S3				Semi-mature	SAVE
191	Douglas fir	Pseudotsuga menziesii		E	Good/Fair		22	S3				Minor storm damage	REMOVE
193	Douglas fir	Pseudotsuga menziesii		E	Good		26	S3					REMOVE
196	Douglas fir	Pseudotsuga menziesii		E	Good		27	S3				Some root disease likley. No hazard at present	REMOVE
198	Douglas fir	Pseudotsuga menziesii		E	Good/Fair		10	S3				Thin upper CR	REMOVE
199	Douglas fir	Pseudotsuga menziesii		E	Good/Fair		17	S3					REMOVE
200	Douglas fir	Pseudotsuga menziesii		E	Good		15	S3				Close grouping. Good vigorous growth	REMOVE
201	Douglas fir	Pseudotsuga menziesii		E	Good		14	S3				Close grouping. Good vigorous growth	REMOVE
202	Douglas fir	Pseudotsuga menziesii		E	Good		18	S3				Close grouping. Good vigorous growth	REMOVE
203	Douglas fir	Pseudotsuga menziesii		E	Good		14	S3				Close grouping. Good vigorous growth	REMOVE
204	Douglas fir	Pseudotsuga menziesii		E	Good		12	S3				Close grouping. Good vigorous growth	REMOVE
209	Douglas fir	Pseudotsuga menziesii		E	Good		22	S5				Semi-mature	REMOVE
212	Douglas fir	Pseudotsuga menziesii		E	Good		16	S5				Trees 2-ft apart	REMOVE
213	Douglas fir	Pseudotsuga menziesii		E	Good		17	S5				Trees 2-ft apart	REMOVE
215	Douglas fir	Pseudotsuga menziesii		E	Good		12	S5					REMOVE
216	Douglas fir	Pseudotsuga menziesii		E	Good/Fair		16	S5				Lost upper leader; resolving defect	REMOVE
217	Douglas fir	Pseudotsuga menziesii		E	Good		17	S5					REMOVE
220	Douglas fir	Pseudotsuga menziesii		E	Good		10	S5					SAVE
221	Douglas fir	Pseudotsuga menziesii		E	Good		13	S5					SAVE
222	Douglas fir	Pseudotsuga menziesii		E	Good		14	S5					SAVE
223	Douglas fir	Pseudotsuga menziesii		E	Good		23	S5					SAVE
224	Oregon white oak	Quercus garryana		D	Fair		10	S5				Suppressed under #219	REMOVE
226	Douglas fir	Pseudotsuga menziesii		E	Good		15	S5				Strong CR development	REMOVE
227	Douglas fir	Pseudotsuga menziesii		E	Good		24	S5				Strong CR development	SAVE
230	Douglas fir	Pseudotsuga menziesii		E	Good		12	S5				Strong CR development	REMOVE
231	Douglas fir	Pseudotsuga menziesii		E	Good		18	S5				Strong CR development	REMOVE
232	Douglas fir	Pseudotsuga menziesii		E	Good		13	S5				Lower stem bend	SAVE
235	Douglas fir	Pseudotsuga menziesii		E	Good		10	S5				Young tree	SAVE
237	Douglas fir	Pseudotsuga menziesii		E	Good		17	S5					REMOVE
238	Domestic pear	Pyrus domestica		D	Fair/Good		12	S5		In pasture area		Twin leaders from 2-ft	REMOVE
265	Oregon white oak	Quercus garryana		D	Good		11	S6				Small CR	REMOVE
266	Oregon white oak	Quercus garryana		D	Good		15	S6		Within low area			REMOVE
267	Oregon white oak	Quercus garryana		D	Good		13	S6		Within low area			REMOVE

[illegible]